PAGE: 1 PRINT DATE: 05/08/96

PART DATA

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL HARDWARE

NUMBER: M5-6MB-2206-G -X

SUBSYSTEM NAME: ELECTRICAL POWER GENERATION - CRYO. GENERIC

REVISION: 9 09/09/92

PART NUMBER VENDOR NUMBER

LRU : MID PCA 1 V070-764400

LRU : MID PCA 2 V070-764430

SRU : CONTROLLER, HYBRID DRIVER MC477-0263-0002

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

CONTROLLER, HYBRID DRIVER (HDC), TYPE III - 02 MANIFOLD 1 AND 2 ISOLATION VALVES - CLOSE POSITION

REFERENCE DESIGNATORS: 40V76A25AR17

PART NAME

VENDOR NAME

40V76A25AR18 40V76A26AR17 40V76A26AR18

QUANTITY OF LIKE ITEMS: 4

FOUR, TWO PER O2 MANIFOLD VALVE CIRCUIT

#### FUNCTION:

100

CONTROLS POWER TO CLOSE 02 MANIFOLD 1 AND 2 ISOLATION VALVES. CONTROL CIRCUITRY IS INDEPENDENT FOR EACH MANIFOLD.

FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE

NUMBER: M5-6MB-2206-G-02

REVISION#: 9

04/16/96

SUBSYSTEM NAME: ELECTRICAL POWER GENERATION - CRYO, GENERIC

LRU: MID PCA 1

CRITICALITY OF THIS

ITEM NAME: CONTROLLER, HYBRID DRIVER

FAILURE MODE: 1R3

FAILURE MODE:

INADVERTENT OUTPUT, FAILS "ON", FAILS TO TURN "OFF"

MISSION PHASE:

LO LIFT-OFF

DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDEAVOUR

CAUSE:

PIECE PART FAILURE, CONTAMINATION, VIBRATION, MECHANICAL SHOCK. PROCESSING ANOMALY, THERMAL STRESS

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) FAIL

C) PASS

PASS/FAIL RATIONALE:

A)

SCREEN "B" FAILS BECAUSE THE SERIES DRIVER CONFIGURATION MASKS THE FAILED "ON" FAILURE MODE OF THE AFFECTED HDC.

C)

## - FAILURE EFFECTS -

#### (A) SUBSYSTEM:

LOSS OF ABILITY TO MANUALLY OPEN THE AFFECTED O2 MANIFOLD VALVE WITH THE PANEL SWITCH.

PRINT DATE: 04/17/96

PAGE: 3

## FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: M5-6MB-2206-G- 02

(B) INTERFACING SUBSYSTEM(S): SAME AS (A)

### (C) MISSION:

NO EFFECT - FIRST FAILURE. POSSIBLE MISSION TERMINATION AFTER THE SECOND FAILURE OF THE ASSOCIATED HDC DUE TO THE OZ MANIFOLD VALVE FAILING CLOSED RESULTING IN ONE TANK BEING ISOLATED TO A SINGLE FUEL CELL AND THE OXYGEN IN THAT TANK CONSUMED.

(D) CREW, VEHICLE, AND ELEMENT(S): NO EFFECT - FIRST FAILURE

### (E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF CREW/VEHICLE DUE TO THE FOLLOWING SCENARIO: 1) FIRST SERIES HDC FAILS "ON", 2) SECOND SERIES HDC FAILS "ON" - AFFECTED O2 MANIFOLD VALVE FAILS CLOSED, AND 3) ASSOCIATED TANK CHECK VALVE FAILS CLOSED RESULTING IN INSUFFICIENT OXYGEN FLOW FOR THE ASTRONAUT'S LAUNCH/ENTRY SUITS (LES). LOSS OF THIS EMERGENCY SYSTEM (LES) MAY OCCUR IN A CABIN/CREW ATMOSPHERE WHERE HARMFUL CONTAMINANTS OR DEPRESSURIZATION MAY EXIST.

## -DISPOSITION RATIONALE-

### (A) DESIGN:

REFER TO APPENDIX B, ITEM NO. 1 - HYBRID DRIVER

#### (B) TEST:

GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD. THE OMRSD DATA PROVIDED BELOW IS NO LONGER BEING KEPT UP-TO-DATE. IF THERE IS ANY DISCREPANCY BETWEEN THE GROUND TESTING DATA PROVIDED BELOW AND THE OMRSD, THE OMRSD IS THE MORE ACCURATE SOURCE OF THE DATA.

CIRCUIT IS FUNCTIONALLY VERIFIED DURING FLIGHT, PERFORM GROUND TURNAROUND TEST IF VALID VERIFICATION IS UNOBTAINABLE IN FLIGHT OR AFTER LRU REPLACEMENT.

## (C) INSPECTION:

REFER TO APPENDIX B, ITEM NO. 1 - HYBRID DRIVER

PRINT DATE: 04/17/96

# FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: M5-6MB-2206-G-02

# (D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE. THE FAILURE HISTORY DATA PROVIDED IN APPENDIX B IS NO LONGER BEING KEPT UP-TO-DATE.

# (E) OPERATIONAL USE:

NO CREW ACTION AFTER FIRST FAILURE.

### - APPROVALS -

PAE MANAGER

PRODUCT ASSURANCE ENGR DESIGN ENGINEERING

**EDITORIALLY APPROVED** 

TECHNICAL APPROVAL

: P. STENGER-NGUYEN :

: J. NGUYEN

: T. D. NGUYEN : JSC

: VIA APPROVAL FORM : 96-CIL-012 M5-6MB.